

name: Matthew Cardamone  
email: m.cardamone@jakcompanies.com  
phone: 8322178821

report group: Playground Inspection  
title: 17902 Hawk Haven Ln.  
created: 12/20/22, 9:59 AM  
modified: 12/21/22, 10:26 AM  
item count: 29

---




created: 12/20/22, 10:02 AM  
modified: 12/20/22, 10:29 AM  
taken by app: Yes  
description: Playground  
36' diameter  
18' radius

Scope of the playground safety inspection:  
the play equipment was inspected against the current CPSC public playground Safety Handbook and ASTM F1487-17. Any equipment that was not in compliance will be reported in this inspection report and the standard will be cited. Any items that the inspector found to be in compliance but that may need to be monitored will also be noted.




created: 12/20/22, 10:03 AM  
modified: 12/21/22, 9:53 AM  
taken by app: Yes  
description: Swing area

ASTM F1487 6.2 Sharp Points and Sharp Edges  
-there shall be no accessible sharp points or edges on public play equipment

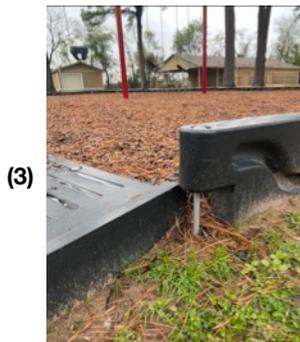

created: 12/20/22, 10:03 AM  
modified: 12/20/22, 10:03 AM  
taken by app: Yes  
description: Ground level entanglement hazard

ASTM F1487 6.4  
-there shall be no entanglement hazards on public play equipment.

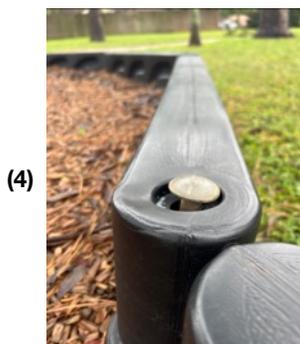

created: 12/20/22, 10:05 AM  
modified: 12/20/22, 10:05 AM  
taken by app: Yes  
description: Entanglement/tripping hazard

ASTM F1487 6.4  
-there shall be no entanglement hazards on public play equipment.  
CPSC 3.6 Tripping Hazard  
-play areas should be free of tripping hazards to children who are using a playground. two common causes of tripping are anchoring devices for playground equipment and containment walls for loose fill surfacing materials.

---

name: Matthew Cardamone  
email: m.cardamone@jakcompanies.com  
phone: 8322178821

report group: Playground Inspection  
title: 17902 Hawk Haven Ln.  
created: 12/20/22, 9:59 AM  
modified: 12/21/22, 10:26 AM  
item count: 29

---

(5)  created: 12/20/22, 10:07 AM  
modified: 12/20/22, 10:07 AM  
taken by app: Yes  
description: Bucket seats need to be lowered

(6)  created: 12/20/22, 10:07 AM  
modified: 12/20/22, 10:07 AM  
taken by app: Yes  
description: Bucket seat need to be lowered

(7)  created: 12/20/22, 10:08 AM  
modified: 12/20/22, 10:08 AM  
taken by app: Yes  
description: Open seat swings need to be lowered

(8)  created: 12/20/22, 10:13 AM  
modified: 12/20/22, 10:13 AM  
taken by app: Yes  
description: S-hook- lower loop should not extend beyond the boundary of the upper loop

[ASTM F1487 6.4.5.1](#)  
-No portion of the closed end of an S-hook lower loop may project beyond the vertical boundary established by the upper loop.



name: Matthew Cardamone  
email: m.cardamone@jakcompanies.com  
phone: 8322178821

report group: Playground Inspection  
title: 17902 Hawk Haven Ln.  
created: 12/20/22, 9:59 AM  
modified: 12/21/22, 10:26 AM  
item count: 29



created: 12/20/22, 10:14 AM  
modified: 12/20/22, 10:14 AM  
taken by app: Yes

ASTM F 1487 6.4.5 Connecting Device  
-connection device such as, but not limited to, S-hooks and C-hooks, when properly closed, are not entanglement hazards. these connectors are considered closed when there is no gap greater than .04 inches.



created: 12/20/22, 10:16 AM  
modified: 12/20/22, 10:16 AM  
taken by app: Yes  
description: Gap greater than .04 in s-hook



created: 12/20/22, 10:19 AM  
modified: 12/20/22, 10:19 AM  
taken by app: Yes  
description: Plenty of loose fill surface material.  
Need swings lowered, rake loose fill so evenly dispersed.

CPSC 4.3 loose-fill surfacing  
-areas under swings and at slide exits. Activity tends to displace surfacing quickly. rake loose-fill back into place.



created: 12/20/22, 10:21 AM  
modified: 12/20/22, 10:21 AM  
taken by app: Yes  
description: Missing signage  
-manufacturer  
- age appropriateness  
-supervision

ASTM F1487 14.1  
-Posting of signs and/or labels shall be the responsibility of the owner/operator of the play equipment. the information regarding the intended ages of users shall be provided by the manufacturer.

name: Matthew Cardamone  
email: m.cardamone@jakcompanies.com  
phone: 8322178821

report group: Playground Inspection  
title: 17902 Hawk Haven Ln.  
created: 12/20/22, 9:59 AM  
modified: 12/21/22, 10:26 AM  
item count: 29

(13)



created: 12/20/22, 10:23 AM  
modified: 12/20/22, 10:23 AM  
taken by app: Yes  
description: Loose fill material needed

[CPSC 4.3 Loose-Fill Surfacing](#)

-loose fill surfacing materials require special maintenance, this can be facilitated by marking ideal surfacing depth on equipment post.

(14)



created: 12/20/22, 10:24 AM  
modified: 12/20/22, 10:24 AM  
taken by app: Yes  
description: Weed barrier showing  
-add loose fill

[CPSC 4.3 Loose-Fill Surfacing](#)

-loose fill surfacing materials require special maintenance, this can be facilitated by marking ideal surfacing depth on equipment post.

(15)



created: 12/20/22, 10:32 AM  
modified: 12/20/22, 10:32 AM  
taken by app: Yes  
description: Loose fill surfacing needed

[CPSC 4.3 Loose-Fill Surfacing](#)

-loose fill surfacing materials require special maintenance, this can be facilitated by marking ideal surfacing depth on equipment post.

(16)



created: 12/20/22, 10:32 AM  
modified: 12/20/22, 10:32 AM  
taken by app: Yes  
description: Bare surface area at slide exit

[CPSC 4.3 Loose-Fill Surfacing](#)

-loose fill surfacing materials require special maintenance, this can be facilitated by marking ideal surfacing depth on equipment post.



name: Matthew Cardamone  
email: m.cardamone@jakcompanies.com  
phone: 8322178821

report group: Playground Inspection  
title: 17902 Hawk Haven Ln.  
created: 12/20/22, 9:59 AM  
modified: 12/21/22, 10:26 AM  
item count: 29

---



created: 12/20/22, 10:35 AM  
modified: 12/20/22, 10:35 AM  
taken by app: Yes  
description: Tripping/entanglement hazard  
along playground border  
- at least 20+ locations of this  
problem

[CPSC 3.6 Tripping Hazard](#)

-play areas should be free of tripping hazards to children who are using a playground. two common causes of tripping are anchoring devices for playground equipment and containment walls for loose fill surfacing materials



created: 12/20/22, 10:36 AM  
modified: 12/20/22, 10:36 AM  
taken by app: Yes  
description: Trip/entanglement hazard

[CPSC 3.6 Tripping Hazard](#)

-play areas should be free of tripping hazards to children who are using a playground. two common causes of tripping are anchoring devices for playground equipment and containment walls for loose fill surfacing materials



created: 12/20/22, 10:39 AM  
modified: 12/20/22, 10:39 AM  
taken by app: Yes  
description: No signage anywhere around  
playground nor on the equipment  
of playground

[ASTM F1487 14.1](#)

-Posting of signs and/or labels shall be the responsibility of the owner/operator of the play equipment. the information regarding the intended ages of users shall be provided by the manufacturer, designer, or consultant.



created: 12/20/22, 10:45 AM  
modified: 12/21/22, 10:26 AM  
taken by app: Yes  
description: Use zone overlapping where not  
permitted

[ASTM F1487 9.8.1](#)

-Sufficient space shall be provided between all adjacent structures and individual play equipment for the purposes of play and circulation.

---



name: Matthew Cardamone  
email: m.cardamone@jakcompanies.com  
phone: 8322178821

report group: Playground Inspection  
title: 17902 Hawk Haven Ln.  
created: 12/20/22, 9:59 AM  
modified: 12/21/22, 10:26 AM  
item count: 29

---



created: 12/20/22, 10:46 AM  
modified: 12/20/22, 10:46 AM  
taken by app: Yes  
description: Paint flakes, chips

CPSC 2.5.4

-Paint and other finishes should be maintained to prevent rusting of exposed metals and to minimize children playing with peeling paint and paint flakes.



created: 12/20/22, 10:47 AM  
modified: 12/20/22, 10:47 AM  
taken by app: Yes  
description: No more than 2 threads shall be showing

ASTM F1487 - 6.4.3

-accessible bolt end projecting beyond the face of the nut more than two full threads is an entanglement hazard.



created: 12/20/22, 10:48 AM  
modified: 12/20/22, 10:48 AM  
taken by app: Yes  
description: No more than 2 threads showing

ASTM F1487 - 6.4.3

-accessible bolt end projecting beyond the face of the nut more than two full threads is an entanglement hazard.



created: 12/20/22, 10:48 AM  
modified: 12/20/22, 10:48 AM  
taken by app: Yes  
description: Top non compliant  
Bottom compliant

ASTM F1487 - 6.4.3

-accessible bolt end projecting beyond the face of the nut more than two full threads is an entanglement hazard.

---



name: Matthew Cardamone  
email: m.cardamone@jakcompanies.com  
phone: 8322178821

report group: Playground Inspection  
title: 17902 Hawk Haven Ln.  
created: 12/20/22, 9:59 AM  
modified: 12/21/22, 10:26 AM  
item count: 29


---



created: 12/20/22, 10:52 AM  
modified: 12/20/22, 10:52 AM  
taken by app: Yes  
description: Main entry/staircase unstable, broke MUST be addressed asap

[ASTM F1487 7.1.1](#)


-accessible routes within a use zone shall conform to the performance requirements of specifications F1292 and F1951.

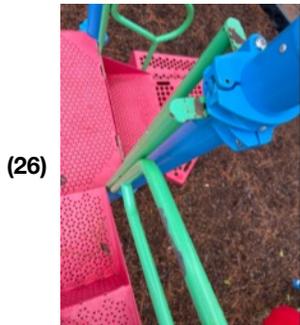

created: 12/20/22, 10:54 AM  
modified: 12/20/22, 10:54 AM  
taken by app: Yes  
description: Paint flaking/chipping

[CPSC 2.5.4](#)

-Paint and other finishes should be maintained to prevent rusting of exposed metals and to minimize children playing with peeling paint and paint flakes.

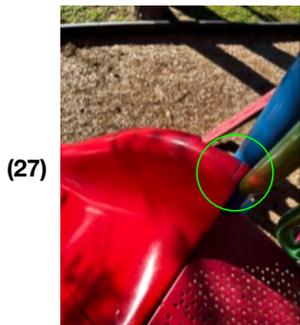

created: 12/21/22, 10:12 AM  
modified: 12/21/22, 10:20 AM  
taken by app: No  
description: Crack in slide side wall.

[ASTM F1487 8.5.1](#)

-Accesses to slides shall meet the same requirements as those for playground equipment in general, as specified in section 7



created: 12/21/22, 10:12 AM  
modified: 12/21/22, 10:19 AM  
taken by app: No  
description: Manufacturer of equipment

**name:** Matthew Cardamone  
**email:** m.cardamone@jakcompanies.com  
**phone:** 8322178821

**report group:** Playground Inspection  
**title:** 17902 Hawk Haven Ln.  
**created:** 12/20/22, 9:59 AM  
**modified:** 12/21/22, 10:26 AM  
**item count:** 29

---

(29)



**created:** 12/21/22, 10:12 AM  
**modified:** 12/21/22, 10:19 AM  
**taken by app:** No  
**description:** Manufacturer of equipment

name: Matthew Cardamone  
email: m.cardamone@jakcompanies.com  
phone: 8322178821  
company: JAK Environmental LLC.

report group: Compliant Park Inspection  
title: 17902 Hawk Haven Ln.  
created: 3/10/23, 9:25 AM  
modified: 3/21/23, 7:04 AM  
item count: 17

---



created: 3/10/23, 9:25 AM  
modified: 3/17/23, 9:19 AM  
taken by app: Yes  
description: Supervision signage is now installed.



created: 3/10/23, 9:26 AM  
modified: 3/17/23, 9:20 AM  
taken by app: Yes  
description: Crack in double slide has been fixed.



created: 3/10/23, 9:27 AM  
modified: 3/17/23, 9:21 AM  
taken by app: Yes  
description: Kiddie Cushion has been blown raising the loose material surface level.



created: 3/10/23, 9:27 AM  
modified: 3/17/23, 9:21 AM  
taken by app: Yes  
description: Double bed red slide where crack was fixed.

---

**name:** Matthew Cardamone  
**email:** m.cardamone@jakcompanies.com  
**phone:** 8322178821  
**company:** JAK Environmental LLC.

**report group:** Compliant Park Inspection  
**title:** 17902 Hawk Haven Ln.  
**created:** 3/10/23, 9:25 AM  
**modified:** 3/21/23, 7:04 AM  
**item count:** 17

---

(5)  **created:** 3/10/23, 9:27 AM  
**modified:** 3/17/23, 9:22 AM  
**taken by app:** Yes  
**description:** Access to first entry step has been restablized with a new footer and proper hardware.

(6)  **created:** 3/10/23, 9:30 AM  
**modified:** 3/17/23, 9:23 AM  
**taken by app:** Yes  
**description:** Age appropriateness and warning signage has been posted.

(7)  **created:** 3/10/23, 9:30 AM  
**modified:** 3/17/23, 9:24 AM  
**taken by app:** Yes  
**description:** Swing mat's and kiddie cushion added at the swing area.

(8)  **created:** 3/10/23, 9:30 AM  
**modified:** 3/17/23, 9:24 AM  
**taken by app:** Yes  
**description:** Border filler added removing entanglement hazard.




name: Matthew Cardamone  
email: m.cardamone@jakcompanies.com  
phone: 8322178821  
company: JAK Environmental LLC.

report group: Compliant Park Inspection  
title: 17902 Hawk Haven Ln.  
created: 3/10/23, 9:25 AM  
modified: 3/21/23, 7:04 AM  
item count: 17

---



created: 3/10/23, 9:32 AM  
modified: 3/17/23, 9:26 AM  
taken by app: Yes  
description: Painted playground sets free of flaking paint.

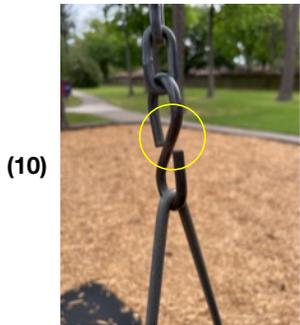

created: 3/20/23, 9:52 AM  
modified: 3/21/23, 6:54 AM  
taken by app: Yes  
description: S-hook upper loop aligns with body and is >.04 inches.



created: 3/20/23, 9:53 AM  
modified: 3/21/23, 6:57 AM  
taken by app: Yes  
description: Upper loop overlaps body, passing loop projection test.



created: 3/20/23, 9:53 AM  
modified: 3/21/23, 6:58 AM  
taken by app: Yes  
description: Tripping hazards have been made flush with border.

**name:** Matthew Cardamone  
**email:** m.cardamone@jakcompanies.com  
**phone:** 8322178821  
**company:** JAK Environmental LLC.

**report group:** Compliant Park Inspection  
**title:** 17902 Hawk Haven Ln.  
**created:** 3/10/23, 9:25 AM  
**modified:** 3/21/23, 7:04 AM  
**item count:** 17

---



**created:** 3/20/23, 9:54 AM  
**modified:** 3/21/23, 7:01 AM  
**taken by app:** Yes  
**description:** Swing height has been adjusted down with the addition of loose fill material and swing mats.



**created:** 3/20/23, 9:54 AM  
**modified:** 3/21/23, 7:01 AM  
**taken by app:** Yes  
**description:** Swing height has been adjusted down with the addition of loose fill material and swing mats.



**created:** 3/20/23, 9:54 AM  
**modified:** 3/21/23, 7:02 AM  
**taken by app:** Yes  
**description:** Swing structure had rust removed and fresh coat of paint.



**created:** 3/20/23, 9:55 AM  
**modified:** 3/21/23, 7:03 AM  
**taken by app:** Yes  
**description:** Yellow climber was removed due to the "use zone" overlapping.

**name:** Matthew Cardamone  
**email:** m.cardamone@jakcompanies.com  
**phone:** 8322178821  
**company:** JAK Environmental LLC.

**report group:** Compliant Park Inspection  
**title:** 17902 Hawk Haven Ln.  
**created:** 3/10/23, 9:25 AM  
**modified:** 3/21/23, 7:04 AM  
**item count:** 17

---

(17)



**created:** 3/20/23, 9:57 AM  
**modified:** 3/21/23, 7:04 AM  
**taken by app:** Yes  
**description:** Protruding bolts have been cut so that no more than 2 threads are showing.